




MOTOR WIRING DIAGRAM

965105

Two Speed – One Winding, Single Voltage

9 Lead, Delta Connection, Variable Torque

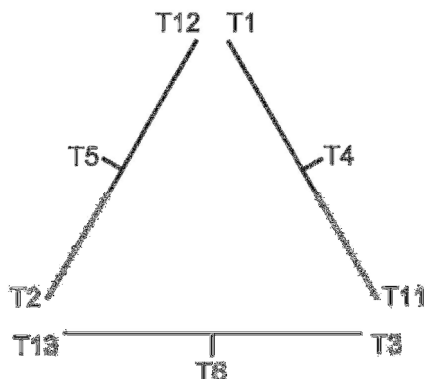

NOTICE

LEAD CONNECTIONS
LOW SPEED

L2 - 1 - 12
L1 - 2 - 13
L3 - 3 - 11
4, 5, 6 OPEN

359282

Low Speed Connection

NOTICE

LEAD CONNECTIONS
HIGH SPEED

L1 - 1 - 11 - 6
L2 - 2 - 12 - 4
L3 - 3 - 13 - 5

359282

High Speed Connection

To reverse rotation, interchange leads L1 & L2.

Each lead may have one or more cables comprising that lead.

In such case, each cable will be marked with the appropriate lead number.